REMARKS / ARGUMENTS

Claim 5 has been amended to remove the optional statement, and this has been presented as added claim 7. This is respectfully submitted to overcome the rejection under 35 U.S.C. 112.

The rejection of claims 4 and 6 under 35 U.S.C. 102(b) as being anticipated by Colibert stal, cited, is respectfully traversed.


In the patented ball hitch coupler, once ball hitch 102 is placed into ball hitch cavity 104, cam pin 103 of polished steel is rotated so that a portion of the cam pin extends out, as shown in Fig. 1, to restrain the ball hitch from being released by coupler housing 101 (col. 3, linea 20-32). The part of the cam pin projecting into cavity 104 correspond to recess 501 (Figs. 5a, 5b) since ball hitch 102 may be placed into the cavity or removed therefrom when the cam pin is in a position in which recess 501 is in cavity 104.

As Fig. 1 shows, that part of cam pin 103 projecting into cavity 104 is relatively small in relation to the diameter of ball hitch 102, which is restrained only along a small portion of its circumference. If the diameter of ball hitch 102 is

PAGE 4/14 * RCVD AT 5/7/2004 3:09:49 PM [Eastern Daylight Time] * SVR:USPTO-EFXRF-1/1 * DNIS:8729326 * CSID:15163659805 * DURATION (mm-ss):03-50

smaller than that of cavity 104, the ball hitch is movable in the cavity. This enables the ball hitch to be moved to the side of ball hitch cavity 104 opposite to cam pin 103 which, in turn, reduces the portion of the cam pin holding ball hitch 102 in the cavity. This increases the tension in the cam pin and in the hall hirch in the contact area between the cam pin and the ball bitch. If the difference in the diameters of the ball hirch and the cavity is too great, the ball hitch may be removed from the cavity even when the cam pin has been rotated into its restraining position go that the ball hitch is no longer held in the cavity. This is shown in the following sketch, in cam pin 103 is shown in its locking position while hall hinch 102 can be removed from cavity 104 because of the relatively small diameter of the ball hitch.

COLLARD&ROE

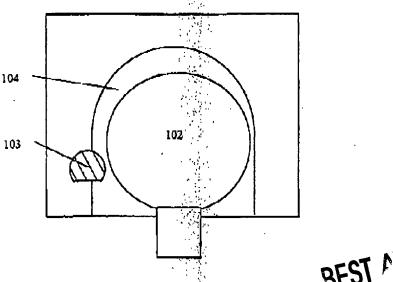

BEST AND ABLE COPY

PAGE 5/14 * RCVD AT 5/7/2004 3:09:49 PM [Eastern Daylight Time] * SVR:USPTO-EFXRF-1/1 * DNIS:8729326 * CSID:15163659805 * DURATION (mm-ss):03-50

It is obvious from the above that it is essential for the Colibert et al arrangement to maintain an accurate correlation between the diameters of ball hitch 102 and ball hitch cavity 104.

It is well known that dimensional inaccuracies occur in the casting of steel, and such inaccuracies are removed by polishing or otherwise treating the surfaces where such inaccuracies exist. Therefore, to obtain the required accuracy between Colibert et al's ball hitch and ball hitch cavity, the crust resulting from the casting process must be removed from ball hitch cavity 104.

In Applicant's coupling decide, ball socket 8 is comprised of molded article 9 and the ball socket is held down on coupling ball 6 from above in the coupling position holding-down clamp 14 (page 3, lines 3/4 of specification). In this coupling position, the ball is securely held in the socket, regardless of any play between hall and socket, because clamp 14 clamps the socket against the ball. In contrast to the restraining of the ball in the socket by the cam pin of Colibert et al, applicant's arrangement tolerates a larger play between ball and socket. Therefore, the casting crust can remain on the interior of the socket, and no further work is needed to adapt the same accurately to the dimension of the ball.

MAY-07-2004 15:18

In view of the above, it is respectfully submitted that the reference of Colibert et al to "cast steel for the coupler housing body" cannot be interpreted as precluding after-treatment of the cast steel. Therefore, claims 4 and 6 arc respectfully submitted to be patentable over the reference.

Applicant encloses a copy of Australian patent application No. 4557/36, whose acceptance was published October 14, 1937. This reference as cited by the australian Patent Office on October 22, 2002. Applicant also encloses Form PTO 1449 and requests the charge of \$150.00 for late filing of the Information Disclosure Statement to be charged to Deposit. Account No.

There is also attached a petition for a three-months extension, with the request to charge the fcc to the above deposit account.

A sincere effort having been made to overcome all grounds of rejection, favorable reconsideration and allowance of claims 4 7 are respectfully solicited.

JEST AVA! COPY

Respectfully submitted,

JOSEF SCHARMULLER

Kurt Kelman, Reg. No. 18,628

Allison, C. Collard, Req. No. 22,532 Edward, R. Freedman, Reg. No. 26,048

COLLARD & ROE, P.C. 1077 Northern Boulevard Roslyn, New York 11576 (516) 365-9902

Attorneys for Applicants

Enclosures:

Copy of Australian patent appin #4557/36

Request for Extension of time

Thereby certify that this correspondence is being sent to the US PTO by telefax, Fax No.: 1-703 672-9326, on May 7, 2004.

Ingrid Mittendorf

1. WSERSWIRE INSOMNEL MANSCHARMUELLER-1 AMEND MAY US WOO

AILABLE COPY